## **Gary Recreation Center- Fire Station**

The Gary New Duluth Senior Citizen Center is currently located in half of Fire Station 10. The space had been mostly abandoned, but recently the community club has become more active and is using the space again. The entry has been modified to eliminate the step to provide an on-grade entry to the main level. The main-level includes meeting/assembly space and 2 single-user toilet rooms. There is also a lower level with a full kitchen, assembly space with stage and multi-fixture toilet rooms- the lower level is not currently occupied. An accessible route is not currently provided to the lower level.

It is the understanding of JQP, Inc. that the community club is considering relocating to the other community club space in Gary known as the 'Shack'. JQP, Inc. supports and would encourage relocating the community club to the 'Shack'.


Location JQP # / Item #	Solution / Comments	Qty	Unit Cost	Total Cost	Priority	Estimated Compl. Date	Person Responsible	Actual Compl. Date	Actual Cost
Lower Level 14D2 160	Relocate program as necessary to an accessible location to provide program access. MN 1341 1104.4  There is not an accessible route to the lower level. Once on the lower level, it is 4 steps down to the assembly area and 4 steps up to the area where the toilet rooms are located (below the fire station). At the time of site visit the lower level was not being used. Photo 5.	1	\$0	\$0	1				
	F	Priority #	1 Total	\$0				Compl.	


Location  JQP # / Iter	m#	Solution / Comments	Qty	Unit Cost	Total Cost	Priority	Estimated Compl. Date	Person Responsible	Actual Compl. Date	Actual Cost
Men's Toil 22-20D	et Roo 16031	m- Main Level  Provide door hardware that does not require grasping, pinching or twisting to operate, such as lever, push pull, etc.  ICC / ANSI 404.2.6	1	\$250	\$250	2				
Women's 22-20D	Toilet F 16024	Room- Main Level Provide door hardware that does not require grasping, pinching or twisting to operate, such as lever, push pull, etc. ICC / ANSI 404.2.6 Photo 4.	1	\$250	\$250	2	//			
			iority#	2 Total	\$500					

## **Gary Recreation Center- Fire Station**

Location JQP # / Iten	n#	Solution / Comments	Qty	Unit Cost	Total Cost	Priority	Estimated Compl. Date Person Responsible	Actual Compl. Date	Actual Cost
Main Entry	1		·	****					
_	16020	Modify the slope of the area necessary for maneuvering clearance to ensure there is no slope greater than 2% (1:48) in any direction. ICC / ANSI 304.2	1	\$4,000	\$4,000	3			
		The slope is currently 8% at the entry. Photos 1 and 2.				_			
12H	16021	Bevel / replace / reset threshold so there is no abrupt rise greater than 1/2" or slope greater than 1:2.  ICC / ANSI 404.2.4	r 1	\$200	\$200	3			
		Currently 1".	Location Su	btotal:	\$4,200				
			-						
Men's Toile	et Rooi	m- Main Level							
22B	16032	Install signage with appropriate raised and Braille lettering. MN 1341 1110.2	1	\$40	\$40	3			
22K6 (MN)	16034	Remove the existing grab bar configuration and replace with a compliant grab bar configuration.  MN 1341 604.5.1 ANSI 604.5.2	1	\$400	\$400	3			
22Q	16033	Insulate or otherwise protect exposed pipes at lavatory. ICC / ANSI 606.6	1	\$50	\$50	3			
<b>22T</b>	16036	Lower the towel dispenser/dryer so the highest operable part is no higher than 48" (44" maximum if located above lavatory or counter).  ANSI 308	1	\$50	\$50	3			
			Location Su	btotal:	\$540				
Office							A 1.8F T		
Office 20D	16038	Provide door hardware that does not require grasping, pinching or twisting to operate, suc as lever.  ICC / ANSI 404.2.6	h 1	\$250	\$250	3			

Location JQP#/Iten	ń#	Solution / Comments	Qty	Unit Cost	Total Cost	Priority	Estimated Compl. Date	Person Responsible	Actual Compl. Date	Actual Cost
Women's T	oilet R	Room- Main Level	<del></del>							
22B	16025	Install signage with appropriate raised and Braille lettering. MN 1341 1110.2	1	\$40	\$40	3				
22K6 (MN)	16027	Remove the existing grab bar configuration and replace with a compliant grab bar configuration.  MN 1341 604.5.1 ANSI 604.5.2	1	\$400	\$400	3				
22Q	16026	Insulate or otherwise protect exposed pipes at lavatory. ICC / ANSI 606.6	1	\$50	\$50	3		•		
22Т	16029	Lower the towel dispenser/dryer so the highest operable part is no higher than 48" (44" maximum if located above lavatory or counter).  ANSI 308	1	\$50	\$50	3				
	· · · · · · · · · · · · · · · · · · ·		Location Sub	total:	\$540					
<del></del>			Priority #	3 Total	\$5,530			<del></del>		

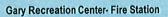

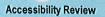

Location JQP#/It	em#	Solution / Comments	Qty	Unit Cost	Total Cost	Priority	Estimated Compl. Date	Person Responsible	Actual Compl. Date	Actual Cost
Entry Vo	atibula									
Entry Ves 14F4	16022	Provide a closet rod mounted no higher than 48" above the floor. ICC / ANSI 308	1	\$100	\$100	4				
		The coat rack is currently at 66".							1	
Kitchen										
25J9	16023	Create an accessible kitchen, including: roll under work surface, roll under sink, range with front or side controls, and compliant clearances.  ANSI 804	1	\$7,000	\$7,000	4				
		Photo 3.								
Lower Le	evel									
20D	16040	Provide door hardware that does not require grasping, pinching or twisting to operate, such as lever.  ICC / ANSI 404.2.6	6	\$250	\$1,500	4				
		If used, replace the knob style hardware on all passage doors.								
Lower Le	evel- Kito	chen								
25J9	16041	Create an accessible kitchen, including: roll under work surface, roll under sink, range with front or side controls, and compliant clearances.  ANSI 804	1	\$7,000	\$7,000	4				
		If used, create an accessible kitchen.								
Lower Le	evel- Me	n's Toilet Room		71						
22.1	16042	IBC 1109.2	1	\$10,000	\$10,000	4				
		If used, remodel the existing toilet room to provide features of accessibility. Photo 6.								

Location JQP # / Item #	Solution / Comments	Qty	Unit Cost	Total Cost	Priority	Estimated Compl. Date	Person Responsible	Actual Compl. Date	Actual Cost
Lower Level- Wo	men's Toilet Room								
22.1 16043	Upgrade toilet room to be fully accessible. IBC 1109.2	1	\$10,000	\$10,000	4				
	If used, remodel the existing toilet room to provide features of accessibility. Photo 6.								
Men's Toilet Roo	m- Main Level								
22C6 (MN) 16037	Relocate the lavatory or enlarge the room to provide a minimum 60" clearance around the water closet, measured perpendicular from the side wall.  ANSI 604.3.2	1	\$5,000	\$5,000	4				
	The room is currently 56" wide overall.								
<b>22N1</b> 16035	Relocate the water closet flush valve so it is located on the open side of the water closet of provide an automatic flush system.  MN1341 604.6	r 1	\$400	\$400	4				
		Location Su	Location Subtotal:						
Women's Toilet F	Room- Main Level								
22C6 (MN) 16030	Relocate the lavatory or enlarge the room to provide a minimum 60" clearance around the water closet, measured perpendicular from the side wall.  ANSI 604.3.2	1	\$5,000	\$5,000	4				
	The room is currently 56" wide overall.								
<b>22N1</b> 16028	Relocate the water closet flush valve so it is located on the open side of the water closet of provide an automatic flush system.  MN1341 604.6	or 1	\$400	\$400	4				
		Location Su	btotal:	\$5,400					
		Priority #	4 Total	\$46,400					



<u>Photo 1:</u> There is a 'no-step' entry into the senior center.



<u>Photo 2:</u> Modify to provide level (2% max) maneuvering space at the entry door.



<u>Photo 3:</u> View of the kitchen. There are currently no features of accessibility provided.



<u>Photo 4:</u> There are 2 single user toilet rooms on the main level.



<u>Photo 5:</u> The route to the lower level. There is not currently an accessible route to the lower level.



<u>Photo 6:</u> Route to the lower level toilet rooms. (No features of accessibility are provided in these toilet rooms.)