Wade Stadium

Activities / Amenities

□ Baseball (4)	Wade Stadium
□ Concession Building	Drinking Fountain
□ Portable Toilet	□ Parking

Baseball

Field 6

Space is not currently provided within the dugouts for a wheelchair space.

JQP, Inc. Recommends

Priority 3- Reconfigure the bench to create a wheelchair space within the dugout. *ADA 221.2.1.4*



Field 6

The opening onto the field is currently 29" clear on the 1st base side (versus 32" minimum).

JQP, Inc. Recommends

Priority 2- Modify the fence to provide a 32" minimum clear opening onto the field. *ADA 404.2.3*



Field 6

There is currently a 6" rise onto the field on the 3rd base side of the field.

JQP, Inc. Recommends

Priority 2- Patch/fill to eliminate the rise onto the field. *ADA* 303



Field 7

Space is not currently provided within the dugouts for a wheelchair space.

JQP, Inc. Recommends

Priority 3- Reconfigure the bench to create a wheelchair space within the dugout. *ADA 221.2.1.4*



Field 7

The opening onto the field is currently 29" clear on the 1st base side (versus 32" minimum).

There is currently a 6" rise onto the field on the 3rd base side of the field.

JQP, Inc. Recommends

Priority 2- Modify the fence to provide a 32" minimum clear opening onto the field. *ADA 404.2.3* **Priority 2-** Patch/fill to eliminate the rise onto the field. *ADA 303*



The pedestrian route to fields 6 and 7 is currently reduced to 29" at the footings (provides 37" between the posts). The route would be blocked by parked vehicles.

JQP, Inc. Recommends

Priority 2- Modify the fence or the footings to provide a 32" minimum clear opening. *ADA 404.2.3* **Priority 3-** Stripe an aisle in the parking lot to ensure that parked vehicles do not block the accessible route. *ADA 206.2.2*

Field 1

There is not currently an accessible route to Field 1.

JQP, Inc. Recommends

Priority 1- Relocate games scheduled on Field 1 to an accessible location to accommodate participants and/or spectators as needed.

Priority 3- Create an accessible route to the field, both dugouts and spectator seating. *ADA 206.2.2, 221.2.1.4*







Field 1

Space is not currently provided within the 1st base dugout for a wheelchair space.

There is currently a rise into the dugouts.

JQP, Inc. Recommends

Priority 3- Reconfigure the bench to create a wheelchair space within the dugout. *ADA 221.2.1.4* **Priority 3-** Patch/fill to eliminate the rise onto the field. *ADA 303*



Field 2

The opening onto the field is currently 23" clear on the 3rd base side (versus 32" minimum).

There is currently a 4" rise into the dugout on the 3rd base side of the field.

JQP, Inc. Recommends

Priority 2- Modify the fence to provide a 32" minimum clear opening onto the field. *ADA 404.2.3* **Priority 2-** Patch/fill to eliminate the rise onto the field. *ADA 303*



Field 2

There is currently an 8" rise into the dugout on the 1st base side of the field.

JQP, Inc. Recommends

Priority 2- Patch/fill to eliminate the rise onto the field. *ADA* 303



Field 2- Bullpen

There is not currently an accessible route to the bullpen on the 1st or 3rd base side of the field.

JQP, Inc. Recommends

Priority 3- Create an accessible route to the bullpens. *ADA 206.2.2*



Fields 1 and 2- Route

The route from the gravel parking lot is a gravel service drive. There are currently segments that have washed out and there is loose gravel.

JQP, Inc. Recommends

Priority 3- Repair the route to provide a firm, stable surface. *ADA 302.1*



Wade Stadium



Wade Stadium

JQP, Inc. prepared a detailed report of the stadium building, it has been included in the facilities report.

Concession Building

Route

There is not currently an accessible route to the concession building located near Field 2.

JQP, Inc. Recommends

Priority 3- Create an accessible route from the gravel parking lot. *ADA* 206.2.2



Concession Counter

There is currently a platform/deck in front of the concession window (on the service side). There is not currently an accessible route onto the platform/deck.

JQP, Inc. Recommends

Priority 3- Remove the platform/deck or add a ramp up to the platform/deck to create an accessible route. ADA 403.4



Drinking Fountain



Drinking Fountain

There is currently a drinking fountain located adjacent to Wade Stadium, near Field 7. The spout of the drinking fountain is currently at 36".

JQP, Inc. Recommends

Priority 3- Add an accessible route to the drinking fountain. *ADA 206.2.2*

Priority 3- Add an additional drinking fountain with a spout at 38"-43". ADA 211.2, 602.7

Portable Toilets

Portable Toilets- Fields 6 and 7

There are currently 3 portable toilets located in the parking lot and adjacent to Fields 6 and 7. There is 1 larger/accessible portable toilet in the parking lot, on an accessible route. This is a good example of accessibility.

JQP, Inc. Recommends

There are no recommendations at this time.



Portable Toilet- Field 1

There is currently a portable toilet located near Field 1. The portable toilet is not an accessible style and is located in the grass/dirt.

JQP, Inc. Recommends

Priority 2- Provide a minimum of 1 larger/accessible style portable toilet at an accessible location. *ADA 206.2.2, 213.2 Exception 3*



Parking



Size

The designated accessible parking spaces are typically 12' wide and do not have aisles.

JQP, Inc. Recommends

Priority 2- Restripe the accessible parking spaces to provide an 8' wide minimum space with an 8' wide minimum aisle. (Note: 2 spaces can share an aisle.) *MN1341 502.4.2*



Signs- Baseball Field

The signs designating accessible parking spaces are currently at 34".

One of the signs is currently missing.

JQP, Inc. Recommends

Priority 3- Raise the signs so they are mounted at 60-66" AFF. MN1341 502.7

Priority 3- Replace the missing sign. MN1341 502.7



Parking- Gravel Lot

There are currently signs designating 3 spaces as accessible in the gravel lot on the west side of the park. The designated accessible spaces are not currently striped (or marked on the gravel surface).

JQP, Inc. Recommends

Priority 2- Stripe/mark the accessible parking spaces to provide an 8' wide minimum space with an 8' wide minimum aisle. (Note: 2 spaces can share an aisle.) *MN1341 502.4.2*

