

Arlington Soccer

Activities / Amenities

- Soccer (4)
- Storage Building
- Portable Toilets
- Parking



Soccer

Route- Field 1

There is not currently an accessible route to the border of Field 1 or to the player seating (movable benches) on the far side of the field.

JQP, Inc. Recommends

Priority 3- Create an accessible route to the boundary of the soccer field. (Approximately 60' from the driveway apron.) *ADA 206.2.2*

Priority 3- Create an accessible route to the player seating or relocate the player seating to an accessible location. *ADA 221.2.1.4*



Route- Fields 2 and 3

There is not currently an accessible route to fields 2 and 3, which are located at the top of a hill.

JQP, Inc. Recommends

Priority 1- Relocate games scheduled on fields 2 and 3 to an accessible location to accommodate participants and/or spectators as needed.

Priority 3- Create an accessible route to the boundary of the soccer field. *ADA 206.2.2*



Route- Paul Antonich Field

There is not currently an accessible route to the boundary of Paul Antonich Field.

JQP, Inc. Recommends

Priority 3- Create an accessible route to the boundary of the soccer field. (Approximately 160' from the driveway apron; a shorter route may be created directly from the parking lot.) *ADA 206.2.2*



Storage Building



Route

There is not currently an accessible route provided to the building used for storage (and electrical) by the soccer association. (Note: the building provides adequate door width and lever style hardware.)

JQP, Inc. Recommends

Priority 3- Create an accessible route to the storage building. *ADA 206.2.2*

Portable Toilets

Portable Toilets

There are currently 4 portable toilets located on a paver pad near the parking lot. Currently none of the portable toilets is a larger/accessible style and there is not an accessible route. (In addition to the curb, the route to the portable toilets can be blocked by parked vehicles.)

JQP, Inc. Recommends

Priority 2- Provide a minimum of 1 larger/accessible style portable toilet at an accessible location. *ADA 206.2.2, 213.2 Exception 3*



Route



Driveway Apron

There is a driveway apron for the gravel service road at the curb. The surface is currently rough, with changes in level exceeding 1/2".

JQP, Inc. Recommends

Priority 2- Patch and repair in order to use the driveway apron as part of an accessible route to the soccer fields and storage building. *ADA 403.2, 406.1*

Parking

Quantity

There is room for approximately 150 vehicles in the parking, including 2 spaces designated as accessible. Based on the total number of parking spaces, a minimum of 5 accessible parking spaces are required.

JQP, Inc. Recommends

Priority 2- Designate 2 additional accessible parking space. *ADA 208.2*

Parking

The designated accessible spaces are currently 9' wide and do not provide an aisle.

The signs designating the accessible parking spaces are currently at 90" AFF.

JQP, Inc. Recommends

Priority 2- Restripe the accessible parking spaces to provide an 8' wide minimum space with an 8' wide minimum aisle. (Note: 2 spaces can share an aisle.) *MN1341 502.4.2*

Priority 3- Lower the parking signs so the bottom edge is 60"-66" above the surface of the parking space. *MN1341 502.7*

