

Lester Golf Course

Activities / Amenities

- Club House
- Driving Range
- Golf Course (27 Holes)
- Parking

Clubhouse

Clubhouse

JQP, Inc. prepared a detailed report of the Clubhouse building, it has been included in the facilities report.



Golf Course



View of Golf Course

A hard surface route is provided throughout the golf course. There are no curbs that obstruct the route of golf cars. *This is a good example of accessibility.*



Golf Cars

There are currently golf cars available for rent. Currently none of the cars can be operated by hand controls.

JQP, Inc. Recommends

Priority 2- Acquire a golf car that can be operated with hand controls.

Driving Range

Route

An accessible route is not currently provided from the parking lot to the driving range building and the tee boxes of the driving range.

JQP, Inc. Recommends

Priority 2- Create an accessible route to the driving range building and the tee boxes. *ADA 206.2.2, 206.2.15*



Building

There are currently knobs used at 2 locations in the driving range building.

JQP, Inc. Recommends

Priority 3- Replace the knob style hardware with a style that does not require any grasping, pinching or twisting of the wrist to operate (such as a lever). *ADA 309*



Ball Machine

There is a self-service machine for range golf balls. The collection area is currently on the floor, below the reach range (15"-48").

JQP, Inc. Recommends

Priority 3- At such time the machine is replaced, ensure that all operable parts (money slot and collection point) are located within reach range. *ADA 308*



Parking



Quantity

There is room for approximately 120 vehicles in the parking lot, including 4 spaces designated as accessible. Based on the total number of parking spaces, a minimum of 5 accessible parking spaces are required.

JQP, Inc. Recommends

Priority 2- Designate 1 additional accessible parking space. *ADA 208.2*



Parking

The designated accessible spaces are not currently striped and do not provide an aisle.

Three of the signs designating the accessible parking spaces are currently too low.

JQP, Inc. Recommends

Priority 2- Restripe the accessible parking spaces to provide an 8' wide minimum space with an 8' wide minimum aisle. (Note: 2 spaces can share an aisle.) *MN1341 502.4.2*

Priority 3- Raise the parking signs so the bottom edge is 60"-66" above the surface of the parking space. *MN1341 502.7*