




18 WDW - HEAD CONDITION AT FACE BRICK/CMU WALL  
 1/1/2" = 1'-0"

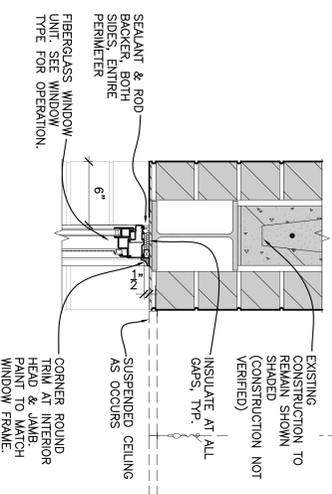


17 WDW - HEAD CONDITION AT BRICK/CMU/BRICK WALL  
 1/1/2" = 1'-0"

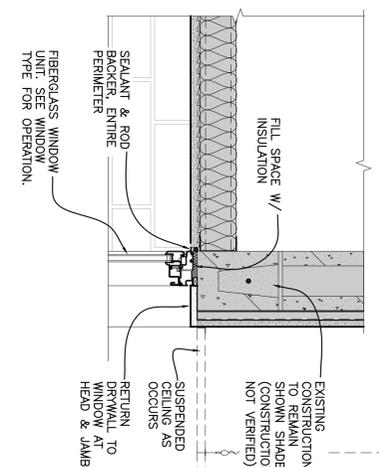


16 HEAD CONDITION AT BRICK/DRYWALL  
 1/1/2" = 1'-0"

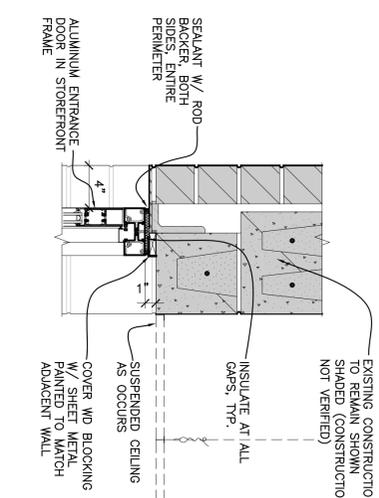


15 HEAD CONDITION AT ALUMINUM ENTRANCE DOOR  
 1/1/2" = 1'-0"

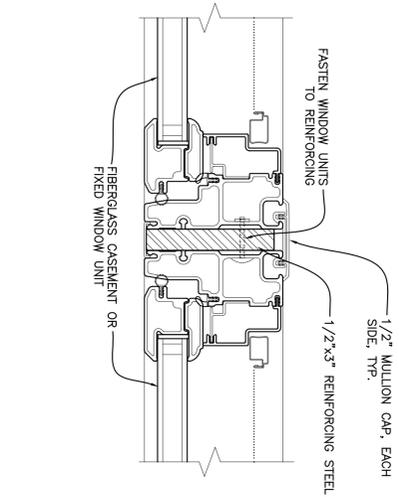


14 FIELD ASSEMBLED REINFORCED MULL  
 1" = 1'-0"

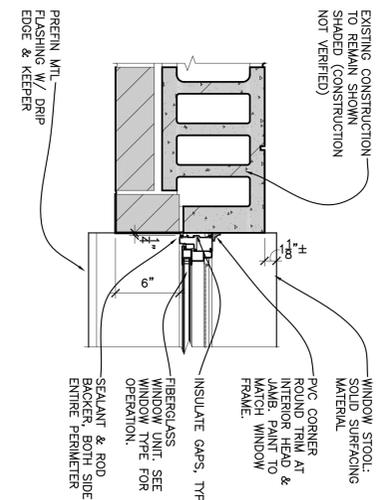


13 WDW - JAMB CONDITION AT FACE BRICK/CMU WALL  
 1/1/2" = 1'-0"

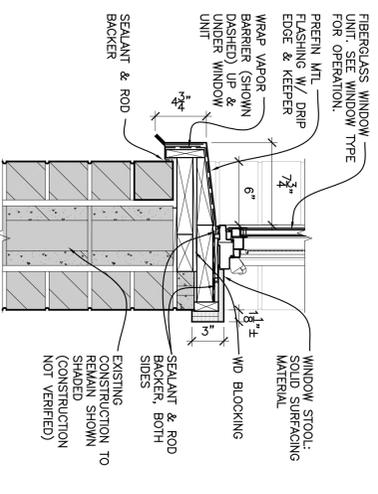


12 WDW - SILL CONDITION AT BRICK/CMU/BRICK WALL  
 1/1/2" = 1'-0"

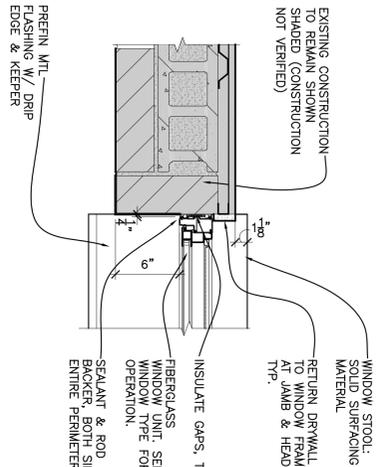


11 JAMB CONDITION AT BRICK/DRYWALL  
 1/1/2" = 1'-0"

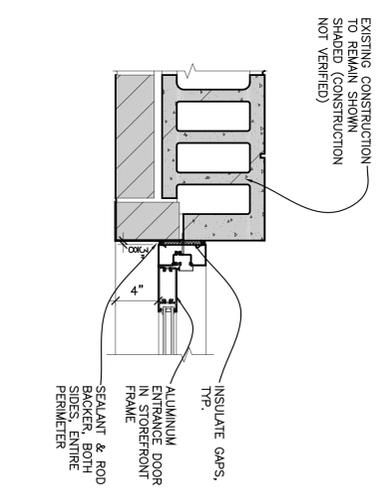


10 JAMB CONDITION AT ALUMINUM ENTRANCE DOOR  
 1/1/2" = 1'-0"

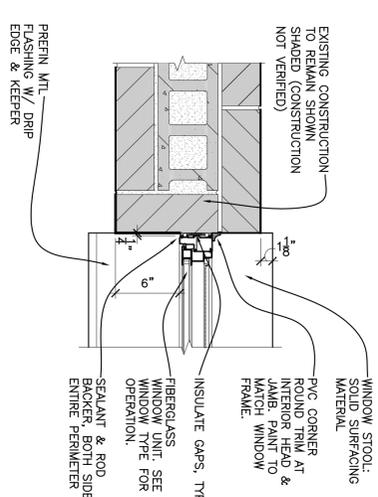


9 JAMB CONDITION AT BRICK/CMU/BRICK  
 1/1/2" = 1'-0"

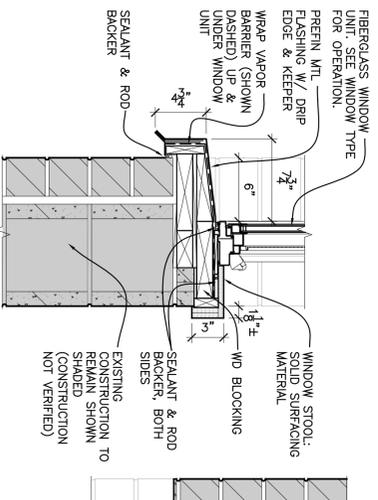


8 WDW - SILL CONDITION AT FACE BRICK/CMU WALL  
 1/1/2" = 1'-0"

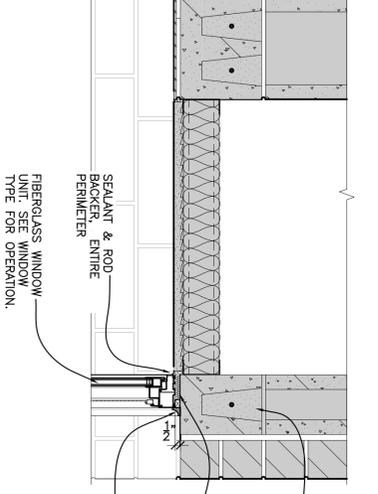


7 HEAD CONDITION AT RECESSED WINDOWS  
 1/1/2" = 1'-0"

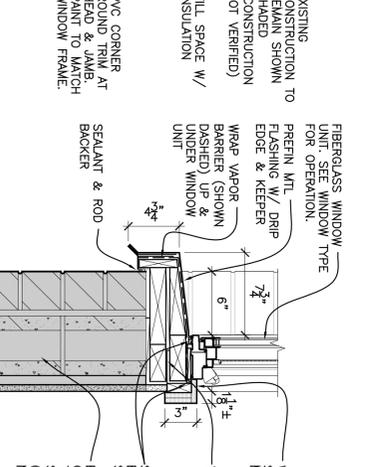


6 WDW - SILL CONDITION AT BRICK/DRYWALL  
 1/1/2" = 1'-0"

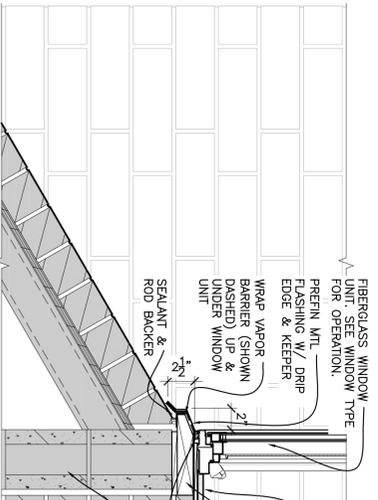

4 SILL CONDITION AT RECESSED WINDOWS  
 1/1/2" = 1'-0"

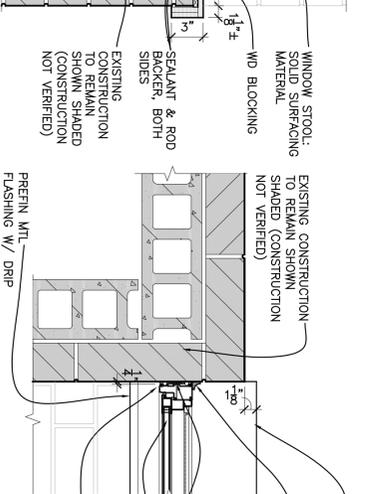

3 JAMB CONDITION AT RECESSED WINDOWS  
 1/1/2" = 1'-0"

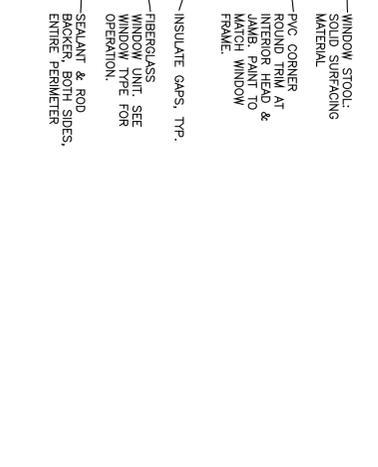

1 SILL AT ALUMINUM STOREFRONT  
 1/3" = 1'-0"

**Central Hillside Community Center**  
 Ext. Door & Window Replacement  
 12 East 4th Street

**CONSTRUCTION DOCUMENTS**

**BIDDING SET**

NO.	DATE	ISSUE RECORD	ISSUED FOR CONSTRUCTION
0	06/21/13		

I HEREBY CERTIFY THAT THIS PLAN, SPECIFICATION, OR REPORT WAS PREPARED BY ME, OR UNDER MY DIRECT SUPERVISION AND THAT I AM A DULY LICENSED ARCHITECT UNDER THE LAWS OF THE STATE OF MINNESOTA.

Signature: *Anthony J. Wucarek*  
 Printed Name: Anthony J. Wucarek  
 License No.: 48047 DATE: 06/21/13

11 East Superior Street, Suite 340  
 Duluth, MN 55802  
 218.724.8578  
 tkda.com

**TKDA**

DESIGNED: KSM DRAWN: KSM CHECKED: RES

**DOOR & WINDOW DETAILS**

**A511**  
 15245.001